


**HAMADA MODEL H234-A**

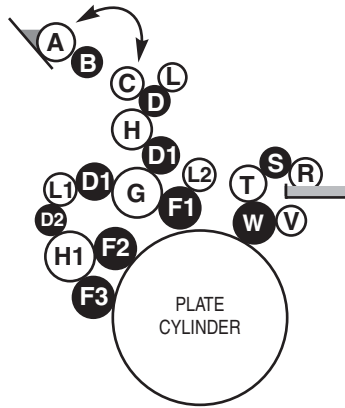

● Soft Rubber Roll      ○ Not Available from SYN-TAC

Syn-Tac Cat. No.	Key	Description	Mfg. Part No.	Roll Dia.	Roll Face Lgth.	Overall Shaft Lgth.
<b>MODEL H234-A</b>						
<b>INK SYSTEM ROLLERS</b>						
234HA14	F1	INK FORM (small)	8203-03005	1 <sup>31</sup> / <sub>32</sub>	13 <sup>7</sup> / <sub>32</sub>	14 <sup>1</sup> / <sub>4</sub>
234HA15	F2	INK FORM (medium)	8203-03006	2 <sup>1</sup> / <sub>16</sub>	13 <sup>7</sup> / <sub>32</sub>	14 <sup>1</sup> / <sub>4</sub>
234HA16	F3	INK FORM (large)	8203-03007	2 <sup>7</sup> / <sub>32</sub>	13 <sup>7</sup> / <sub>32</sub>	14 <sup>1</sup> / <sub>4</sub>
234HA26	D	INK DISTRIBUTOR (small)	8203-04006	1 <sup>23</sup> / <sub>32</sub>	13 <sup>1</sup> / <sub>2</sub>	15 <sup>9</sup> / <sub>32</sub>
234HA27	D1	INK DISTRIBUTOR (large)	8203-04008	2 <sup>1</sup> / <sub>16</sub>	13 <sup>1</sup> / <sub>2</sub>	15 <sup>9</sup> / <sub>32</sub>
234HA28	D2	INK DISTRIBUTOR (medium)	8203-04007	1 <sup>29</sup> / <sub>32</sub>	13 <sup>1</sup> / <sub>2</sub>	15 <sup>9</sup> / <sub>32</sub>
234HA31	B	INK DUCTOR	8203-06001	1 <sup>9</sup> / <sub>32</sub>	13 <sup>7</sup> / <sub>32</sub>	15 <sup>17</sup> / <sub>32</sub>
234HA19*	—	BLANKET WASH ROLLER	8203-09001	1 <sup>17</sup> / <sub>32</sub>	13 <sup>7</sup> / <sub>8</sub>	16 <sup>5</sup> / <sub>32</sub>
<b>WATER SYSTEM ROLLERS</b>						
234HA43P	W	WATER FORM	8203-13004	2 <sup>5</sup> / <sub>32</sub>	13 <sup>9</sup> / <sub>32</sub>	16 <sup>5</sup> / <sub>16</sub>
234HA53P	S	WATER METERING	8203-13003	1 <sup>21</sup> / <sub>32</sub>	15 <sup>3</sup> / <sub>8</sub>	17 <sup>3</sup> / <sub>8</sub>

\* Bushings are NOT included.

**CARE CHEMICAL TIP:**

Here is a safe and easy way to remove calcium carbonate glaze from your rollers:

Wash all ink from the rollers with **X75-122** followed with **X75-123**. Disengage the clean-up attachment and pour **X75-111** deglazer over the rollers. Let the press run for five to ten minutes, adding more of the **X75-111** as needed. Engage the clean-up attachment to remove all of the **X75-111**.

Remember: the amount of **X75-111** needed will depend on the amount of alkaline build-up. The alkaline will neutralize the **X75-111** as the calcium carbonate is dissolved.

**The roller store**

**(229) 241-8022**